

## FIELD REPORT

---

**DATE:** Thursday June 28th, 2012

**PROJECT:** Independence Park Main Library

**WEATHER CONDITIONS:** Clear - 66°

**SITE CONDITIONS:** Dry

**REPORTED BY:** Lisa C. Hargrave, AIA - The Library Design Collaborative

**IN ATTENDANCE:** Lisa C. Hargrave, Vic Todd, Pierce Langridge, Robbie Posey, George Griffon

### OBSERVATIONS:

1. The architect reviewed the site conditions in advance of the 3<sup>rd</sup> floor deck pour from 01-06 and the pile cap pour at 15 & A25, A27
2. At the third floor the following was noted and conveyed to the contractor:
  - a. At the north roof area along columnline 57 the architect noted several channel stub-ups that needed to be removed. In this location the parapet wall is beyond column 57 allowing the studs to be cantilevered from below negating the need to steel in this area. (RE: 1AE352)
  - b. In reference to RFI no. 53, Design Change Request by the Contractor of the Parapet Electrical Outlets, the stub ups were placed outside of the parapet on the south roof although the change had not been approved. The architect conveyed to the contractor that these needed to be moved.
  - c. At the slab edge near columnline 52 at columnline A05, the architect noted an offset in the edge angle alignment. The contractor indicated that this mal-alignment would be remedied in the stud wall furring in this area to create a smooth and flush wall.

**ATTACHMENTS:** One page of photographs.



Refer to note 2a



Refer to note 2c



Refer to note 2b

